

GM Gen. 2 6T30, 6T40, 6T45, 6T50

sonnax®


2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



Zip Kit®
6T40-GEN2-ZIP

This Sonnax kit is also available,
see www.sonnax.com for details.

1 144510-05K
**Oversized TCC
Control Valve Kit**

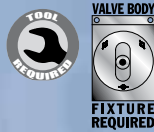


Helps cure:

- Excess TCC slip • Low cooler flow
- Overheating • Low converter & lube flow
- TCC codes

Note: Requires tool kit **F-144510-TL5C**
& the **VB-FIX** reaming fixture.

2 144740-16K
**Oversized TCC
Regulator Valve Kit**

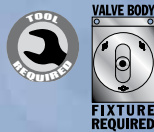


Helps cure:

- Code P0741 • Code 742 • No lockup
- TCC slip • Loss of fuel economy
- Low TCC apply pressure

Note: Requires tool kit **F-144740-TL16**
& the **VB-FIX** reaming fixture.

3 144510-12K
**Oversized Pressure
Regulator Valve Kit**

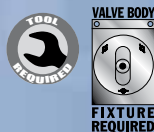

Helps cure:

- Burnt clutches • Erratic line pressure
- Low converter & lube flow • Overheating

Note: Requires tool kit **F-144510-TL12C**
& the **VB-FIX** reaming fixture.



4 144740-01
**Oversized Actuator
Feed Limit Valve**



Helps cure:

- No 4th • No 5th • No 6th
- Low clutch oil pressure
- Harsh shifts • Flare shifts

Note: Requires tool kit **144740-TL**.

5 144510-14K Includes 6 End Plugs
O-Ringed End Plug Kit

Helps cure:

- Pressure loss • Burnt clutches
- Shift concerns • TCC apply concerns

Note: Proper identification of this
valve body and pump is critical.
See unit page at www.sonnax.com
for identification guide.

**Click on Sonnax part numbers to
see more information.**