

Ford 6F50, 6F55

sonnax®


2 Imtec Lane • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



Zip Kit®
6F50-ZIP

This Sonnax kit is also available, see www.sonnax.com for details.

1 124740-14K Oversized TCC Control Valve Kit

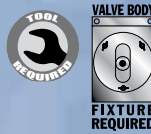


Helps cure:

- TCC apply/release concerns
- Low cooler flow

Note: Requires tool kit F-124740-TL14 & the VB-FIX reaming fixture.

2 124740-24K Oversized TCC Regulator Valve Kit

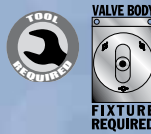

Helps cure:

- Harsh/No TCC apply
- Codes 741, 742

Note: Requires tool kit F-124740-TL24 & the VB-FIX reaming fixture.

3 124740-03K Isolator Valve Kit

Helps cure:

- No/Low line pressure
- Line pressure instability

4 124740-16 Isolator Valve Spring

5/Bag

Helps cure:

- No/Low line pressure
- Line pressure instability


5 124740-17K Oversized 2-6 Clutch Regulator Valve Kit



Helps cure:

- 2nd & 6th Gear shift concerns
- Burnt 2-6 clutch

Note: Requires tool kit F-124740-TL17 & the VB-FIX reaming fixture.

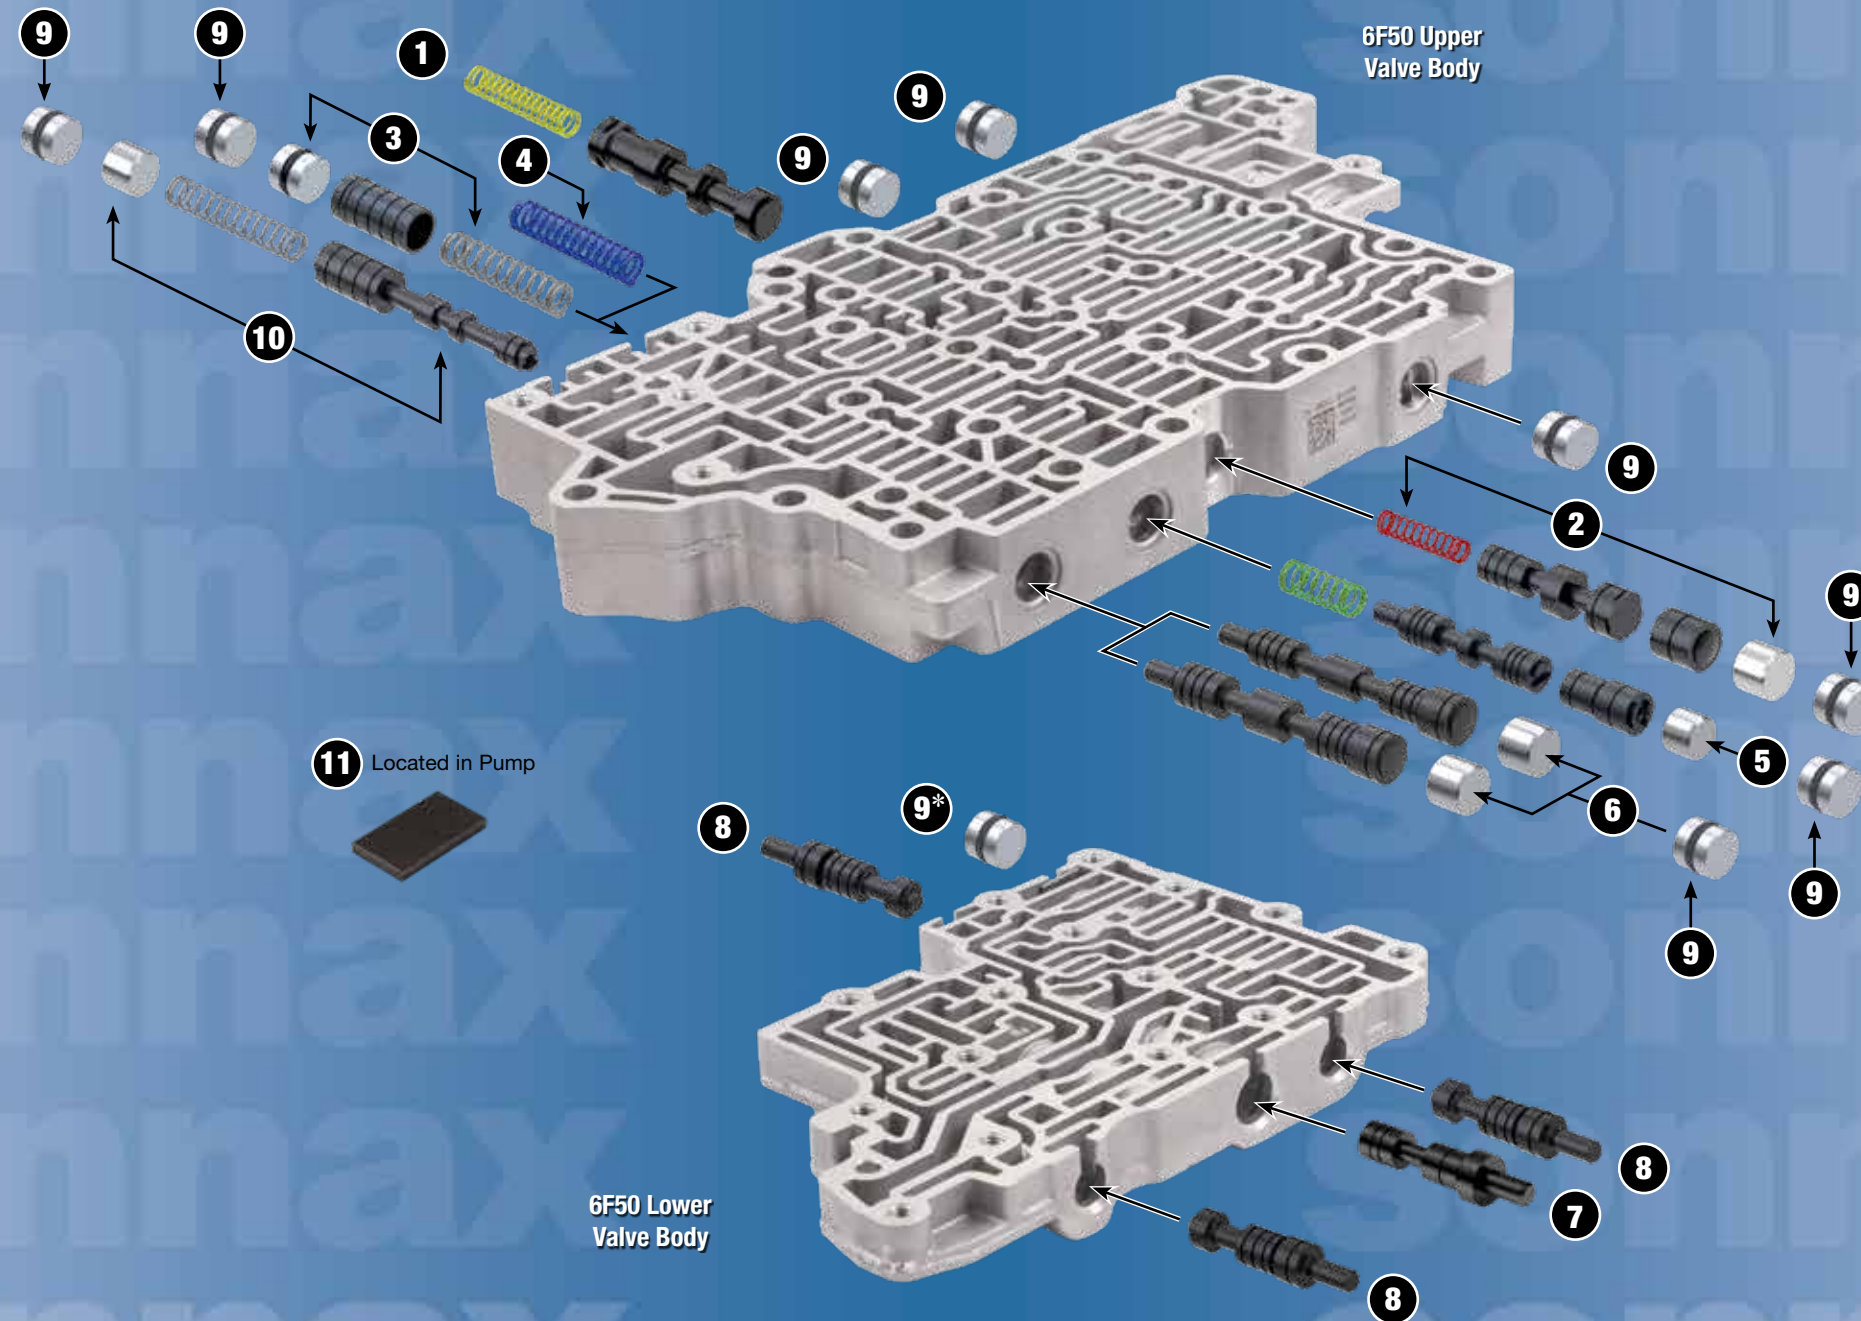

6F50 Upper
Valve Body

6F50 Lower
Valve Body

11 Located in Pump

Click on Sonnax part numbers to see more information.

11 124533 Pump Valve

Helps cure:

- Lost or damaged component

6 124740-21K 124740-26K

1.83 Ratio

1.35 Ratio

Oversized 3-5-R Clutch Regulator Valve Kits



Helps cure:

- 3rd & 5th Gear shift concerns
- Burnt 3-5-R clutch

Note: 124740-21K requires tool kit F-124740-TL21, 124740-26K requires tool kit F-124740-TL26 & they both require the VB-FIX reaming fixture.

7 124740-01 Oversized AFL/Solenoid Pressure Regulator Valve



Helps cure:

- Solenoid codes
- Wrong gear starts

Note: Requires tool kit F-104740-TL12 & the VB-FIX reaming fixture.

8 144740-23 Oversized Clutch Boost/Latch Valve



Helps cure:

Fits Any of 3 Locations

- Slips/Flares/Burnt clutches
- Delayed engagement

Note: Requires tool kit F-144740-TL22 & the VB-FIX reaming fixture.

9* 124740-02K O-Ringed End Plug Kit


Fits 9 Locations

Helps cure:

- Shift concerns
- Burnt clutches

***Note:** O-Ringed end plug should not be used on later 6F50/6F55 applications without short shuttle valve and that have long (approximately .940") end plug.

10 124740-12K Oversized Pressure Regulator Valve Kit

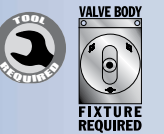

Helps cure:

- Harsh/Soft shifts
- Burnt clutches

Note: Requires tool kit F-124740-TL12 & the VB-FIX reaming fixture.